

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 31 **Township:** 7N **Range:** 2E

Corner ID: Polk e- 25


Monument Description & Remarks: 3 1/4" aluminum cap on metal pipe.

References On File: Kenneth Anderson survey. Recorders book 3 page 386 & 392.


Field Book: 2000-02

Page No.: 42

USGS Quad: Norman

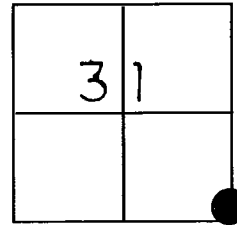

Tie Sheet Drawing
(Not to Scale)

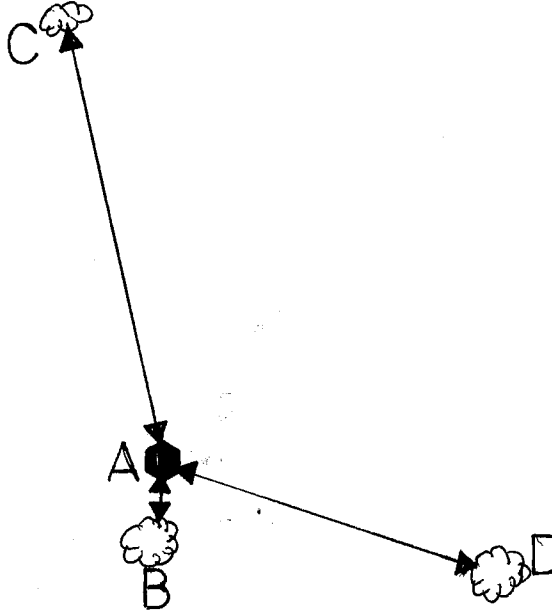



A-2 1/4" aluminum cap.

B-S 13 ° W 3.65' to MAG nail in 9" black gum. Survey Marker 5' A.G.

C-N 06 ° W 21.88' to MAG nail in 14" white oak.

D-S 40 ° E 15.23' to MAG nail in 10" black gum.

I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of Section 36-2-12-11 of the Indiana Code; and the above data is given under my hand this 26th day of October, 2000.

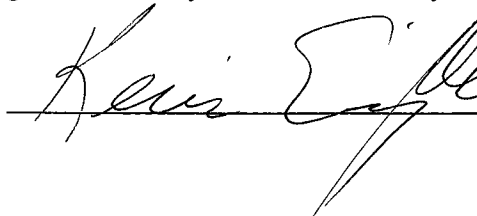Certified and sealed by the Monroe County Surveyor Review Board

Date: December 14, 2000



November 28, 2000

Index No. 2-5
(Alphabetical - Numerical)


LAND CORNER RECORD (RECTANGULAR SURVEYS)

R9-5680-11 (5/12/81)

T. 7N R. 2E 2nd Mer. N.F. Hoosier County Monroe State Indiana
South Section Corner common to sections 31 32 and

EXISTING SURVEYS

Original Government Survey	Original Evidence Found
Year surveyed <u>1811</u>	Year of search <u>1986</u> By <u>V.H.M.</u>
Original monument <u>Wood Post</u> <small>(Wood post, stone, pile of stones, pipe, etc.)</small>	Monument found <u>None</u>
Bearing Trees	
Species <u>R. Oak</u> <u>W. Oak</u>	Original Bearing Trees Found
Diameter <u>18"</u> <u>8"</u>	Species <u>Stump Hole</u>
Bearing <u>S 70 E</u> <u>N 84 W</u>	Diameter <u>24"</u>
Distance <u>19'</u> <u>34'</u>	Bearing <u>N 84 W</u>
	Distance <u>22'</u>
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed <u>1856</u> By <u>James W. Spencer</u>	Year of search <u>1986</u> By <u>V.H.M.</u>
Where filed or recorded <u>Monroe Co. Surveyors Book</u>	Recovered stone with faint X cut in top.
Monument <u>None Listed</u> <u>Book 1, Page 294</u> <small>(Original, concrete post, iron rod, etc.)</small>	
<u>1911 By Charlie M. Bowers, Monroe Co. Surveyors Book Volume 3, Page 39. No monument listed</u>	
Bearing Trees, Reference Objects	
Species <u>W. Oak</u> <u>Gum</u> <u>W. Oak</u>	<u>Gum</u> <u>W. Oak</u>
Diameter <u>15"</u> <u>3"</u> <u>12"</u>	<u>9"</u> <u>18"</u>
Bearing <u>N 16 E</u> <u>S 46 1/2 E</u> <u>N 79 W</u>	<u>S 45 E</u> <u>N 70 W</u>
Distance <u>25 Lks.</u> <u>23 Lks.</u> <u>35 Lks.</u>	<u>15.5'</u> <u>23.5'</u>
<u>(1856)</u> <u>(1911)</u> <u>(1911)</u>	<u>(1911)</u> <u>(1911)</u>

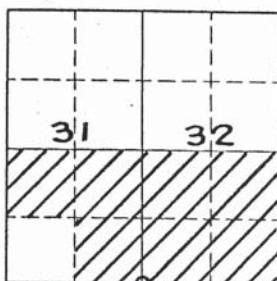

Sketch

○ Corner □ F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____
Object _____
Record distance _____
Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc. Cite source of testimony if any. Corner is situated on west face of north south ridge line 75'± west of west rim of ridge 200'± south of horse trail. Old downed barbed wire fence 3.5' south running east and 2' west running north.

Perpetuation Record

Monument and accessories established. Include brief description of area. Replaced stone with 30" aluminum monument. Stone was buried beside monument.

Accessories Established:

R. Gum	W. Oak
8"	9"
S 5 W	S 72 W
3.7'	40.5'

Certified corner restoration certificate prepared: Yes _____ No _____
Filed in county records at _____ Date _____ County Document No. _____
Identified on aerial photo No. _____ Which is filed at _____

At time of search:

1. Did you have the record description?
Yes _____ No X _____

2. How was search area located?
Pacing, chaining, photos, maps, etc. chaining

3. Man hours spent in search 3

4. Do you think additional search might recover evidence? Yes _____ No X _____

5. Signature Vick H. McCarty


Index No. 20
(Alphabetical - Numerical)LAND CORNER RECORD
(RECTANGULAR SURVEYS)

R9-7150-4 (Rev. 6/13/67)

GPO 802-127

T. 7N R. 2E 2nd Mer. N.F. Hoosier County Monroe State Indiana
SE 1/4 Corner common to sections 31 32 6 and 5

EXISTING SURVEYS	
Original Government Survey	Original Evidence Found
Year surveyed _____	Year of search _____ By _____
Original monument _____ (Wood post, stone, pile of stones, pipe, etc.)	Monument found _____
Bearing Trees	Original Bearing Trees Found
Species _____	Species _____
Diameter _____	Diameter _____
Bearing _____	Bearing _____
Distance _____	Distance _____
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed _____ By _____	Year of search <u>11-6-1985</u> By <u>Mike Hilderbrand</u>
Where filed or recorded _____	<u>Recovered sandstone 2" x 9" extends</u>
Monument _____ (Original, concrete post, iron rod, etc.)	<u>1" above ground level. Approx 12" + in</u>
	<u>ground. Has (+) on top of stone.</u>
	<u>No scribing</u>
Bearing Trees, Reference Objects	Bearing Trees, Reference Objects
Species _____	<u>Stump Hole</u>
Diameter _____	<u>N 89° W</u>
Bearing _____	<u>23.55 Feet</u>
Distance _____	

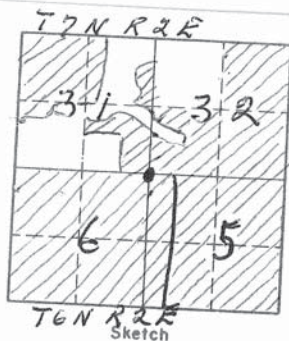

○ Corner ■ F.S. Land

At time of search:

1. Did you have the record description?
Yes _____ No _____2. How was search area located?
Pacing, chaining, photos, maps,
etc. _____

3. Man hours spent in search _____

4. Do you think additional search might
recover evidence? Yes _____ No _____

5. Signature _____

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____
Object _____
Record distance _____
Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc. Cite source of testimony if any. Stone is located in fence
Row 3.50 Feet North of Fence corner on West
Facing slope Fence running North and East.
Wood Trail Approx. 125 Feet North of Stone
Stone is in South-West corner of old field
Tree line running North and East

Perpetuation Record

Monument and accessories established. Include brief description of area.
Establish following Bearing Trees

<u>Gum</u>	<u>White Oak</u>
<u>8"</u>	<u>18"</u>
<u>S 45° E</u>	<u>S 46° W</u>
<u>15.50 Feet</u>	<u>33.60 Feet</u>

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____